



www.functionaldevices.com

## **AC TRANSDUCERS**

## **RIBXK420 Series**

Enclosed Self-Powered Solid Core 20, 50, and 100 Amp Current Transducers with Loop Powered 4-20 mA Output (Pre-Wired)

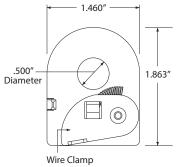

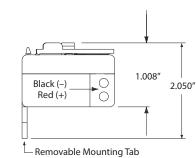




## **SPECIFICATIONS**

Operating Temperature:	-30 to 140° F 5 to 95% (noncondensing)			
, ,	Red (positive) & Black (negative), 16", 18 AWG, 600V Rated			
	Internal, with 4-20 mA Transmitter Output			
· · · · · ·	: 0-20 Amps, 0-50 Amps, or 0-100 Amps			
	(See Selection Guide Below)			
Accuracy:	96.4% FS			
Linearity:	99% FS (25%-100% Span)			
Max Output Current:	30 mA			
Max Sense Voltage:	600 Vac			
Approvals:	UL Listed, UL916, UL864, C-UL, California State Fire Marshal, CE, RoHS			
Mounting/Installation:	Removable mounting tab provided. The wire clamp locks against the			
	wire being monitored, securing the unit in place.			
<b>RIBXKTV SERIES</b>	S SELECTION GUIDE			

NDART V SERIES SELECTION GOIDE			
Model#	Sensing Range	Sensor Output	
RIBXK420-20	0-20 Amps	Loop Powered 4-20 mA Transmitter (Pre-Wired)	
RIBXK420-50	0-50 Amps	Loop Powered 4-20 mA Transmitter (Pre-Wired)	
RIBXK420-100	0-100 Amps	Loop Powered 4-20 mA Transmitter (Pre-Wired)	



OUTPUT LOAD RESISTANCE	SUPPLY VOLTAGE	
Maximum	Minimum	Maximum
700 ohms	26 Vdc	35 Vdc
600 ohms	24 Vdc	35 Vdc
500 ohms	21 Vdc	35 Vdc
400 ohms	19 Vdc	30 Vdc
300 ohms	17 Vdc	30 Vdc
250 ohms	16 Vdc	28 Vdc
200 ohms	14 Vdc	28 Vdc
100 ohms	12 Vdc	28 Vdc
50 ohms	11 Vdc	28 Vdc